



# **Nitric Oxide Detector-Transmitter**

## E2608-NO

**User Manual** 



# **Table of contents**

Nitric oxide	3
Specifications	4
Product description	6
Safety requirements	6
Operating conditions	6
Installation guidelines Wall mount version Duct mount version	<b>7</b> 7 7
Mounting dimensions	8
Sensor probe handling	9
Gas sensor replacement procedures	9
Electrical connections Correct and incorrect cabling for 24 VAC	<b>10</b> 12
Operation	13
Maintenance	13
Calibration	13
Delivery set Order code for E2608-NO options	<b>14</b> 14
Configuring	15
Return to default settings	15
Modbus RTU Communication RS485 communication interface Communication parameters	<b>16</b> 16 16
Modbus holding registers	16
Warranty	21
Manufacturer contacts	21

## Nitric oxide

A colorless toxic gas, relatively insoluble in water. When exposed to oxygen (including air), nitric oxide is converted into nitrogen dioxide.

Chemical formula		NO
Molar weight		30
Relative gas density	(to air)	1.03
Conversion		1 ppm = 1.23 mg/m <sup>3</sup>
Boiling point		-152 °C
Flammability		Nonflammable, but accelerates the burning of combustible materials.
Odor		Pure NO is odorless, but in the air, it oxidizes to $NO_2$ which has a pungent odor
Hazards		Irritates respiratory tract and eyes, at high concentrations may cause lung edema and death.
Exposure limits	TWA	30 mg/m <sup>3</sup> /25 ppm
(Directive 91/322/EEC)	IDLH (NIOSH)	123 mg/m³ /100 ppm

Conversion of ppm to  $mg/m^3$  is calculated for 25°C and 1 atm.

## Specifications

Sensor type	Electrochemical cell
Sampling method	Diffusion
Typical detection range	0250 ppm
Maximum overload	1000 ppm
Resolution / digital unit	1 ppm
Response time T90	< 40 s
Sensor lifetime	> 12 months
Calibration interval	6 months
Signal update	Every 1 second
Power supply	1236 VDC (default), 24 VAC or 230 VAC as options
Power consumption	< 2 VA
Load resistance	R <sub>L</sub> < (Us - 2 V) / 22 mA for 4-20 mA R <sub>L</sub> > 250 kOhm for 0-10 V mode
Digital interface	RS485, Modbus RTU protocol No galvanic isolation
Analog outputs	2 × 4-20 mA / 0-10 V, user settable
Outputs assignment	OUT1: Gas; OUT2: Gas
Output scale width	> 10 × resolution Recommended: 20-100% of the detection range
Relay outputs	2 × SPST, max 5 A, 30 VDC / 250 VAC
Default alarm setpoints	RE1 (LOW): set 10 ppm, release 8 ppm RE2 (HIGH):set 25 ppm, release 20 ppm
Cable connections	Screwless spring loaded terminals
Enclosure	Grey ABS, wall mount, protection class IP65
Dimensions	H87 × W82 × D55 mm
CE marking	According to 2014/30/EU and 2014/35/EU, EN 50491-4-1:2012 EN 61000-6-3:2020, EN 61326-1:2013(EMC, emissions) EN 61000-6-1:2019, EN 61000-6-2:2019(EMC, Immunity) EN 60079-29-1:2016, EN 60079-29-2:2015 and EN 60079-29-3:2014

Operating conditions	-3050 °C, 1590% RH non-condensing, 0,91,1 atm explosion safe indoor areas, non-aggressive atmosphere <b>NOTE!</b> The sensor may exhibit considerable sensitivity to hydrogen sulfide and nitrogen dioxide			
Other options				
Remote probe	Protection IP65, default cable length 3.0 m; max height 80 mm, max diameter 65 mm			

#### Product description

E2608 series detectors-transmitters belong to the PluraSens® family of multifunctional measurement instruments. The instruments utilize gas sensors of various types with excellent repeatability, stability, and long lifetime.

E2608 series provides two independent analog outputs OUT1 and OUT2, user-selectable to 4-20 mA or 0-10 V. RS485 Modbus RTU digital communication interface allows easy instrument configuration and integration into various automation systems.

Two relays RE1 and RE2 with closing dry contacts can be used to switch alarm sirens, ventilation fans, shut-off valves, or other actuators. Remote probe, duct mount version and 24 VAC or 230 VAC power supply options are available.

The version of your detector-transmitter is marked on the package. If the symbol  $\Lambda$  is marked on the equipment, consult the documentation for further information.

#### Safety requirements

Misuse will impair the protection of the product. Always adhere to the safety provisions applicable in the country of use.

Do not perform any maintenance operation with the power on. Do not let water or foreign objects inside the device.

Removal of the PCB from the enclosure voids the warranty. Do not touch the electronic components directly, as they are sensitive to static electricity.

Connection diagrams can be found in the electrical connections section. The device might not perform correctly or be damaged if the wrong power supply is connected.

External circuits connected to the equipment should have sufficient insulation rating according to the environmental conditions and equipment power.

A disconnecting device that is marked as such and easily accessible should be included in the installation of this product.

#### **Operating conditions**

The device should be used both in a non-hazardous area and in a basic electromagnetic environment, where the latter is defined in EN 61326-1. Avoid strong mechanical shock and vibrations. Avoid corrosive atmosphere and areas highly contaminated with dust, oil mist, etc. Keep the instrument away from direct sunlight. A sudden temperature or humidity change might affect the sensitivity of the sensor.

## Installation guidelines

Before proceeding with the installation it is mandatory to read the Safety requirements section and make sure to comply with all listed instructions. Installation standards EN 60079-29-2 and EN 45544-4 are also recommended for further instructions and related information about the installation. During the installation of the detector-transmitter the following points must be considered:

- Application (air quality control or leakage detection)
- Properties of the space under investigation (room geometry, direction, and velocity of airflows, etc.),
- Nitric oxide has practically the same density as air. As it is easily oxidized to form nitrogen dioxide, the sensor should be placed as close as possible to the gas source.
- The device should be accessible for maintenance and repair.

The aforementioned conditions above will affect the coverage area of the device. however, the coverage area for a detector-transmitter is usually between 2.5 to 5 meters radius.

For early leakage detection install the sensor as close as possible to the potential leakage sources (flanges, valves, pressure reducers, pumps, etc.), taking into consideration other points listed above.

For general area monitoring without definite leakage sources, the detector-transmitters should be distributed evenly in the room.

For personal safety control, the detector-transmitters are installed in the breathing zone (at the height of the head of people or animals). The recommended sensor position is vertical, pointing downwards.


#### Wall mount version


Attach the mounting lugs to the back of the detector-transmitter using the provided screws. Screw the device to the wall through the mounting lug holes (for dimensions see the drawing in the next section).

#### Duct mount version

Cut a hole with a diameter of 36...45 mm in the air duct at the chosen mounting place. Place the rubber flange aligning the holes in the flange and the air-duct and fix the flange with four self-tapping screws. Pass the sensor probe through the flange and adjust it to the appropriate depth. Unscrew four lid screws and detach the lid from the detector-transmitter.

## **Mounting dimensions**

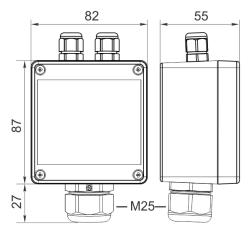

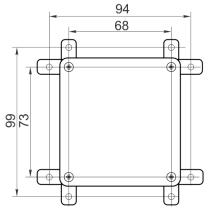

Wall mount version


with mounting lugs

Duct mount version

M25

#### Sensor probe handling

The wall-mount version of the detector-transmitter is available with a remote probe (see drawing below for dimensions). The remote probe is connected to the main unit with a shielded cable. The default remote probe cable length is 3 m.

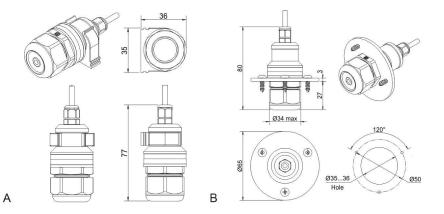

- A) Wall mount remote probe with fixing clamp (default version),
- B) Remote probe with rubber flange and three self-tapping screws (on request)

The sensor probes of all types are equipped with a hydrophobic microporous PTFE filter to protect the sensor from dust, dirt, and water drops. The filter should be replaced if it gets strongly contaminated. To replace the PTFE filter, unscrew the sensor head cap and remove the old filter. Place a new filter into the cap and tighten it again.

**NOTE!** Never stab or press the filter near its center where the sensor is located since this may damage the sensor. Do not remove the filter as it may cause the device to show incorrect values and/or break the sensor.


The recommended orientation of the sensor probe is vertical with the sensor tip pointing downwards. This prevents the possible accumulation of condensed water on the sensor protection filter.

Gas sensor replacement procedures

- 1. Remove the sensor head cap from the device (or the remote probe),
- 2. Remove the PTFE filter (if it is not removed within the cap),
- 3. Remove the O-ring rubber,
- 4. Detach the electrochemical sensor from the device,
- 5. Insert the new electrochemical sensor inside,
- 6. Put back the O-ring rubber, PTFE filter, and the head cap, respectively.

### **Electrical connections**

Unscrew four lid screws and detach the lid from the device. Use the M16 cable gland to let in cables of the power supply and of the external devices. Attach the power cable to the device without turning it on. Using the connection diagram below, connect the analog outputs and digital interface terminals to the relevant devices according to your tasks.

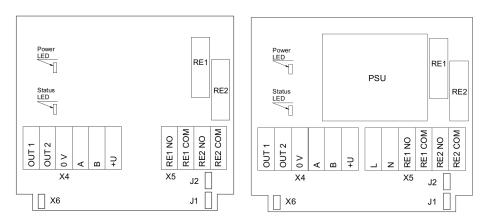

Version without PSU

Version with PSU

Jumpers	
J1	OUT1 type (open: 4-20 mA; closed 0-10 V)
J2	OUT2 type (open: 4-20 mA; closed 0-10 V)
X6	Reset Modbus network parameters to default
X4 terminals	
OUT1	4-20 mA / 0-10 V output
OUT2	4-20 mA / 0-10 V output
0V	0 V / 24 VAC Neutral (optional)
Α	RS485 A / Data +
В	RS485 B / Data -
+U	+24 VDC / 24 VAC Phase (optional)

X5 terminals (optional)		
L	90265 VAC Phase	
Ν	90265 VAC Neutral	
RE1 NO	Relay 1, normally open terminal	
RE1 COM	Relay 1, common terminal	
RE2 NO	Relay 2, normally open terminal	
RE2 COM	Relay 2, common terminal	

The screwless quick connect spring terminals on the E2608 series devices are suitable for a wide range of wires with a cross-section of  $0.2...1.5 \text{ mm}^2$ . We recommend to strip the wire end by 8...9 mm and use wire end sleeves.

To connect the wire, insert the wire end into the terminal hole. To disconnect, push the spring-loaded terminal lever, pull the wire out, and release the lever.


Use a twisted-pair cable, e.g. LiYY TP 2×2×0.5 mm<sup>2</sup> or CAT 5, to connect the device to the RS485 network. A and B on the device represent DATA+ and DATA- respectively, polarity must be respected when connecting to an external RS485 network.

Both analog outputs can be independently changed between 4-20 mA and 0-10 V type using jumpers J1 (OUT1) and J2 (OUT2). By closing pins on a specific jumper the related output is 0-10 V, with an open jumper the output is 4-20 mA. Power restart is required after changing the position of the jumpers.

**NOTE!** The outputs are not galvanically isolated from the external power supply and share a common 0V. Allowed load resistance limits are stated in the Specifications table. To power the instrument from an external power source, connect terminals 0V and +U to the source. If the integrated mains power supply module is used, connect terminals L and N to the mains.

**NOTE!** Actuator short-circuits should be avoided, to protect the instrument relays using external fuses or safety switches.

#### Correct and incorrect cabling for 24 VAC

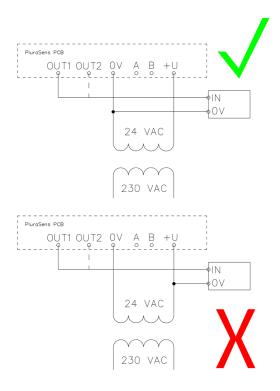

### Operation

Turn on the power. The instrument warm-up time takes about 30 minutes after switching on and the final sensor stabilization time to maximum accuracy takes about 12 hours, but depending on the device condition it might take longer to stabilize. The operating status is indicated by the LED on the PCB of the device. The control LED (red) response to different processes is presented in the following table:

Mode	LED mode
During calibration mode or sensor heating period (if activated)	0.5 Hz (50% on, 50% off)
Relay 1 turned on	Blinking 1 Hz (50% on, 50% off)
Relay 2 turned on	Blinking 2 Hz (50% on, 50% off)
During the Modbus communication cycle	Short on-off pulses
Normal operating/measurement	Continuously on or off

Make sure that the detector-transmitter is properly mounted, the external devices connected, power LED (green) on, and the control LED (red) is constantly lit. Place the lid back and fix it with the screws. The device is ready to use.

#### Maintenance

Do not perform any maintenance operation with the power on.

Clean the device with a soft damp cloth. Do not use any abrasive cleaning agents. Do not immerse the device in water or any cleaning media.

#### Calibration

E2608-NO detector-transmitters have been calibrated by the Manufacturer with standard gas mixtures before delivery. Provided that the sensor is used under moderate conditions, field recalibration is recommended every 6 months Please contact your dealer for more information.

#### **Delivery set**

- Detector-transmitter E2608 (wall mount or duct mount version)
- Mounting accessories:
  - 4 cross-shaped mounting lug with screws and 4 screws with plastic dowels for wall mount version
  - Square Rubber flange for Duct mount option
  - Round rubber flange for Remote probe option
  - Fixing clamp for Remote probe option



#### Order code for E2608-NO options

E2608 options	Order code
Remote probe, 3 m cable	E2608-NO-RP33-3
Remote probe, 10 m cable	E2608-NO-RP33-10
Duct mount option, stem Ø35×L230 mm	E2608-NO-DM
Integrated 90265 V mains power supply module	E2608-NO-230
Integrated 24 VAC power supply module	E2608-NO-24VAC
Remote LCD single value display, wall mount box 115 × 65 × 40mm, 3 m cable	E2608-NO-RLCD3

## Configuring

A standard configuration kit includes a USB-RS485 converter, fixed flow regulator, gas tubing with applicators, and a software pack. Please contact your Seller for more information.

Gas detector-transmitters E2608 share all functionalities of the PluraSens® multifunctional detector-transmitter platform. The features and options include:

- Digital output change rate-limiting filter
- Digital integrating (averaging) filter
- Free assignment of each analog output to the chosen parameter
- Flexible setting of analog output scales for each output
- Output zero and slope adjustment for calibration
- Free assignment of each of two relays to the chosen parameter
- Several relay control logic modes
- Switch delays and minimum on/off state durations for each relay

The output scales can be changed by Modbus commands by using the configuration software and the standard configuration kit (see Modbus RTU Communication).

#### **Return to default settings**

To reset the device's Slave ID, baud rate, and stop bit numbers to factory settings, proceed as follows:

- 1. De-energize the device
- 2. Connect the X6 jumper
- 3. Turn on the device
- 4. De-energize the device
- 5. Disconnect the X6 jumper
- 6. Turn on the device

## Modbus RTU Communication

#### **RS485** communication interface

Databits: 8 Parity: none / odd / even Stop bits: 1 or 2 Protocol: Modbus RTU	Supported Modbus functions: 03 – Read multiple registers 06 – Write a single register
---	---

#### **Communication parameters**

Parameter	Permitted values	Default
Supported baud rates	1200, 2400, 4800, 9600, 19200, 38400, 57600	9600
Data bits	8	8
Parity	none / odd / even	none
Stop bits	1, 2	1
Protocol	Modbus RTU	
Modbus functions	03 - Read multiple registers 06 - Write a single register	
01 - Illegal function 02 - Illegal data addressError codes03 - Illegal data value 04 - Slave device failure (details of last error 04 can be read from register 0x0008)		08)

### Modbus holding registers

Register addresses are shown 0-based, Address in hexadecimal, Reg in decimal format. Modbus holding register numbers MHR are shown in the decimal 1-based format and may be addressed either from 00001 or 40001 base.

Address	Reg / MHR	RW	Description	Supported values (dec)	Default
0x0001	1 / 40002	R	Hardware version		-
0x0002	2 / 40003	R	Software version		-
0x0003	3 / 40004	R	Product serial number	165535	-
0x0004	4 / 40005	RW	Slave ID (net address) *	1247 **	1

	= / /000/			1200, 2400, 4800, 9600, 19200,	
0x0005	5 / 40006	RW	Baud rate *	38400, 57600	9600
0x0006	6 / 40007	RW	Response delay, ms	1255	10
0x0007	7 / 40008	RW	Stop bits, parity bit *	1 - No parity bit, 1 stop bit (default after factory reset) 2 - No parity bit, 2 stop bits 3 - Odd parity, 1 stop bit 4 - Even parity, 1 stop bit <b>NOTE</b> : 3 and 4 are available starting from the Software version 0x218 (dec. 536)	1
0x0008	8 / 40009	R	Last error code	1255	-
0x0011	17 / 40018	RW	Technological: age of last data in seconds (read) / restart (write)	065535 s (read), writing 42330 restarts the instrument	-

Address	Reg / MHR	RW	Description	Supported values (dec)	Default
0x00A5	165 / 40166	RW	Zero adjustment for gas data, ADC	-32000+32000 ADC units	0
0x00A6	166 / 40167	RW	Slope adjustment for gas data	165535	512
0x00A7	167 / 40168	RW	Change rate limit for gas data, units / s	132000, 0 - no limit	0
0x00A8	168 / 40169	RW	Integrating filter time constant, s	132000 (seconds), 0 - no filter	0
0x00C9	201 / 40202	RW	Parameter tied to analog output 1	0 – None 2 – Gas concentration 9 – Forced Modbus control, value set in MHR / 40204	2
0x00CA	202 / 40203	RW	Parameter tied to analog output 2	0 – None 2 – Gas concentration 9 – Forced Modbus control, value set in MHR / 40205	2
0x00CB	203 / 40204	RW	Forced value for analog output 1***	01000 (0.0%100.0% of output scale)	0
0x00CC	204 / 40205	RW	Forced value for analog output 2***	01000 (0.0%100.0% of output scale)	0

0x00D3	211 / 40212	RW	Parameter tied to relay RE1	0 -none 2 - gas concentration 9 - control by Modbus control, state set in MHR / 40214	2
0x00D4	212 / 40213	RW	Parameter tied to relay RE2	0 – none 2 – gas concentration 9- – control by Modbus control, state set in MHR / 40215	2
0x00D5	213 / 40214	RW	Forced state for relay RE1***	0 –off, 1 – on	0
0x00D6	214/ 40215	RW	Forced state for relay RE2***	0 – off, 1 – on	0
0x00D7	215 / 40216	RW	Switching delay for relay RE1	01000 (s)	0
0x00D8	216 / 40217	RW	Switching delay for relay RE2	01000 (s)	0
0x00D9	217 / 40218	RW	Minimal on/off time for relay RE1	01000 (s)	0
0x00DA	218 / 40219	RW	Minimal on/off time for relay RE2	01000 (s)	0

Address	Reg / MHR	RW	Description	Supported values (dec)	Default
0x00DB	219 / 40220	RW	Control logic for relay RE1	$1 \xrightarrow{1}_{L} \xrightarrow{1}_{H} \xrightarrow{1}_{H}$	0
0x00DC	220 / 40221	RW	Control logic for relay RE2	$1 \xrightarrow{1}_{L} \xrightarrow{2}_{H} \xrightarrow{1}_{H} \xrightarrow{1}_{H}$	0

0x00DD	221 / 40222	RW	LOW setpoint for relay RE1	065535 (gas units)	see Specifications
0x00DE	222 / 40223	RW	HIGH setpoint for relay RE1	065535 (gas units)	see Specifications
0x00DF	223 / 40224	RW	LOW setpoint for relay RE2	065535 (gas units)	see Specifications
0x00E0	224 / 40225	RW	HIGH setpoint for relay RE2	065535 (gas units)	see Specifications
		_			
0x00FF	255 / 40256	RW	Sensor, analog outputs, LED and buzzer status	bit[0]=0/1 - sensor present/absent, <b>RO</b> bit[1]=0/1 - analog outputs deactivated/activated bit[2]=0/1 - in case the sensor is absent, turn signaling off/on analog output1 bit[3]=0/1 - in case the sensor is absent, turn on signaling with low current/high current on analog output1; if bit[2]=0 this bit will be ignored bit[4]=0/1 - in case of sensor absent, turn signaling off/on analog output2 bit[5]=0/1 - in case of sensor absent, turn on signaling with low current/high current on analog output2 bit[5]=0/1 - in case of sensor absent, turn on signaling with low current/high current on analog output2; if bit[4]==0 this bit will be ignored bit[6]=0/1 - current/voltage output detected on output1, <b>RO</b> bit[7]=0/1 - LED deactivated/activated bit[10]=0/1 - LED deactivated/activated bit[10]=0/1 - LED is on/off in normal condition bit[11]=0/1 - 1 Hz (50% on, 50% off) LED signal off/on if relay1 turned on bit[12]=0/1 - 2 Hz (50% on, 50% off) LED signal off/on if relay2 turned on	user defined

0x0101	257 / 40258	R	Raw gas sensor data	04095, ADC units	
0x0103	259 / 40260	R	Gas concentration, gas units	065535, gas units	
0x0105	261 / 40262	RW	0% value for analog output 1	-32000+32000, gas units	User defined
0x0106	262 / 40263	RW	100% value for analog output 1	-32000+32000, gas units	User defined
0x0107	263 / 40264	RW	0% value for analog output 2	-32000+32000, gas units	User defined
0x0108	264 / 40265	RW	100% value for analog output 2	-32000+32000, gas units	User defined

\* - The new value is applied after restart.

\*\* - Broadcast slave ID 0 can be used to assign a new ID to the instrument with an unknown ID. When addressing by ID 0 the device shall be the only Modbus instrument in the network. The device will not respond to the Master command when addressed by ID 0.

\*\*\* – This value is dynamic and not kept in EEPROM after a restart.

#### Warranty

This product is warranted to be free from defects in material and workmanship for a period of one year from the date of the original sale. During this warranty period, the Manufacturer will, at its option, either repair or replace a product that proves to be defective. This warranty is void if the product has been operated in conditions outside ranges specified by the Manufacturer or damaged by customer error or negligence or if there has been an unauthorized modification.

#### **Manufacturer contacts**

Evikon MCI OÜ

Teaduspargi 7/9, Tartu 50411 Estonia info@evikon.eu www.evikon.eu

CE 🗵